



This Service Information bulletin supersedes S.I. B84 61 06 dated **October 2006**.

NEW designates changes to this revision

SUBJECT

CCC Navigation System Pop-up Arrow Display Missing During Route Guidance

MODEL

E90, E91, E92 (3 Series) with CCC-Navigation SA 609

E60, E61 (5 Series) with CCC-Navigation SA 609

E63, E64 (6 Series)

NEW E70 (X5) with CCC-Navigation SA 609

SITUATION

The customer states that the navigation system pop-up arrow display is missing during route guidance. This only occurs when the right hand CID (Central Information Display) assist window has the navigation map displayed.

CAUSE

This fault has occurred on vehicles that have been programmed using CIP V19.1 or higher

NEW PROCEDURE

On a customer complaint basis only, update the complete vehicle using Program V25.00.00 or higher per SI B09 05 01 (Coding, Individualization, Programming) Procedure B.

Once the vehicle software is updated, the customer may enter into the settings menu and select "Language/Units". The pop-ups can be toggled on/off.

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty.

Defect Code	Refer to KSD
Labour Operation:	Refer to KSD
Labour Allowance:	Refer to KSD