

BMW Group
Dealer: 32711/06
Model: M2
Development code: G87
Model code: 13DM
Lead type: 13DM

Service Information Bulletin

RECALL 23V-039: SIDE AIR BAG COVER (REAR SEATS)

B52 01 23 [SI] February 2023

This Service Information Bulletin (Revision 2) replaces SI B52 01 23 dated **February 2023**.

What's New (Specific text highlighted):

Please perform the procedure outlined in this Service Information on all affected vehicles before customer delivery. In the event the customer has already taken delivery of the vehicle, please perform the procedure the next time the vehicle is in the shop.

designates changes to this revision

Complaint

SITUATION

BMW AG is conducting a Voluntary Safety Recall (effective January 26, 2023) on certain Model Year 2023 BMW 2 Series Coupe and M2 models that were produced between October 24, 2022 and January 17, 2023.

The side air bag cover panel on the rear seats may not have been produced to specifications by the supplier. In certain crashes where side air bag deployment is warranted, the cover panel may crack. If this happens, then the side air bag may not deploy as intended, which could increase the risk of injury.

The Recall Notice and Q&A have been attached for further information.

Cause

CAUSE

Supplier backrest side panel material does not meet design criteria.

Measure

MODEL

E-Series	Model Description	Production Date
G42	2 Series Coupe	October 24, 2022 – January 17, 2023
G87	M2 Coupe	November 1, 2022 – January 16, 2023

CORRECTION


Replace both rear seat backrest side panels which contain the air bag.

PROCEDURE

	Replace the rear seat backrest side panels (left and right; circled) in accordance with repair instructions
--	---



52 26 008
(backrest
side panel at
the rear seat
back).

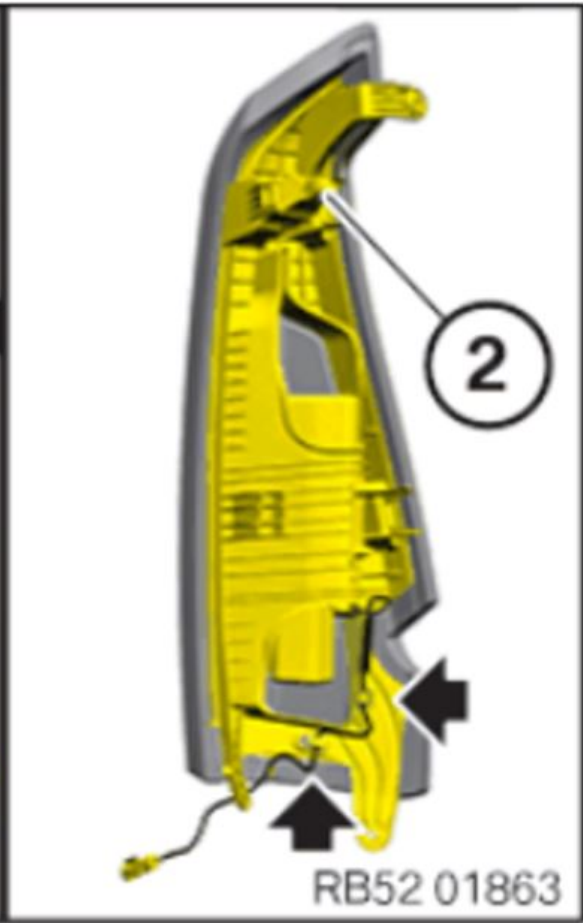

Unclip and
remove the
backrest
side panel
section (1)
on the rear
seat
backrest
from the
clamp (2).

Check the
clamp (2)
for damage.
A
replacement
clamp
should be
present on
the new
part.

Repeat for
opposite
side of
vehicle.

RB52 01863

The serial number of the removed air bag AND the new air bag must both be stated on the repair order and in the comments section of the warranty claim.

PARTS INFORMATION

Obtain and confirm the part numbers for your specific vehicle by entering the chassis number in either ETK or AIR which considers specific equipment and/or options.

Part Number	Description	Quantity
52 20 5A04135	side panel left 1 (according to equipment)	1
52 20 5A04136	side panel right 1 (according to equipment)	1
52 20 5A04137	side panel left 1 (according to equipment)	1
52 20 5A04138	side panel right 1 (according to equipment)	1
52 20 5A04141	side panel left 1 (according to equipment)	1
52 20 5A04142	side panel right 1 (according to equipment)	1
52 20 5A04143	side panel left 1 (according to equipment)	1
52 20 5A04144	side panel right 1 (according to equipment)	1
52 20 5A04145	side panel right 1 (according to equipment)	1
52 20 5A04146	side panel left 1 (according to equipment)	1

PARTS RETENTION AND RETURN

The parts replaced to perform and submit for this repair procedure are the property of BMW NA. Your center is responsible for the proper identification, storage and documentation of these parts.

They must be held in a secure retention area until notification of claim payment is made by BMW NA through DCSnet.

If these replaced parts are requested to be returned, a corresponding DCSnet Part Return tag will generate. Any requested parts that are not received by the WPRC in accordance with Section 6 of the Warranty Policy and Procedure Manual may be subject to debit.

Warning: The specific inflatable air bags for this recall are NOT classified as dangerous goods (DG) by the Department of Transportation (DOT). They thereby do not require special preparation, packing and labeling for transport.

For other questions or inquiries concerning this issue, please contact the WPRC via IDS or through its help desk at 610-365-3065.

CLAIM INFORMATION

Reimbursement for this Recall will be via normal claim entry utilizing the applicable work package information below and the part numbers listed above that apply.

Defect Code: 0052090200	G42 G87 US Replace side section of rear seat backrest
--------------------------------	---

Completion before the first vehicle delivery to a customer or the vehicle is already in the workshop

Work Pkg	Labor Operation	Description (Plus work)	Labor Allowance
# 1	00 73 819	Replace both backrest side sections on the rear seat backrest (second row of seats)	3 FRU (G87); 5 FRU (G42)

Or:

The vehicle arrives at your center and this Recall shows open (No other Main work will be performed or claimed during this workshop visit)

Work Pkg	Labor Operation	Description (Main work)	Labor Allowance
# 2	00 73 235	Replace both backrest side sections on the rear seat backrest (second row of seats)	5 FRU (G87); 7 FRU (G42)

Only one of the flat rate labor operation codes listed above can be used for claim submission and reimbursement. Also, only one Main work flat rate labor operation code can be claimed per workshop visit.

Claim Repair Comments

Only reference the SIB number and the work package (Pkg) number performed in the RO technician notes and the claim comments (for example: B52 01 23 WP 1), unless otherwise required by State law.

Reimbursement of Prior Customer-Pay Repairs (TREAD Act)

Based on the issue and the age of the Affected Vehicles being addressed by this Safety Recall Campaign, a reimbursement request for a qualifying prior customer-pay repair is not likely.

However, if you do receive a reimbursement request from a customer for a prior repair that may qualify, please contact the Warranty department (include a legible copy of the invoice) through IDS by selecting Coverage, Policy, Coding Questions and Mileage Corrections. The Warranty department will review and respond to your inquiry accordingly.

FEEDBACK REGARDING THIS BULLETIN

Technical Feedback	To submit feedback for the technical topic of this bulletin: Submit your feedback in the rating box at the top of this bulletin
Warranty Feedback	To submit feedback for the CLAIMS section of this bulletin: Submit an IDS ticket to the Warranty Department, or use the chat available in the Warranty Documentation Portal
Parts Feedback	To submit feedback for the PARTS section of this bulletin: Submit an IDS ticket to the Parts Department

Validity information

AFFECTED VEHICLES

Vehicles which require this campaign to be completed will show it as "Open" when checked either in AIR, AWP, Campaign Summary or Warranty Vehicle Inquiry.

Please make sure you check your dealer inventory as soon as possible. A list of affected vehicles can be seen in Inventory Campaign Details (ICD) under ROSS.

Service Information Bulletin Metadata

Model series: G87, G42
Engine range: S58T, B48D, B58D
Body style: COUPE
Fault codes:

Repair overviews

Attachments

B520123_23V-039-G42-G87-SideAirBagCover-FAQ-(26Jan2023).PDF

B520123 Recall Notice.PDF